

OTHER ACCESSORIES:

Work done to preserve existing monument. A 5' steel t-post was set 0.7' west of the rebar with a Monroe County Surveyor Marker sign attached 3.0' above grade.

VICINITY DESCRIPTION: Corner location relative to nearby features and how to reach the corner - note fences, roads, timber, streams, topo changes, etc.
The monument is on the east side of Henderson Street, 5.3' east of the back of curb.

ORIGIN:

The rebar was set by Jess Gwinn to replace a referenced stone that was destroyed during development to the southeast.

HISTORY: Monroe County Surveyor Kevin Enright's field notes dated 2/20/1998 in field book 98-01, page 42 state: "referenced stone was obliterated with development to the southeast. Talked to Jess Gwinn RLS of Smith Neubecker Engineering who were setting control for the development, and agreed to reset this point. Found set rebar w/ cap."

NOTES:

- Field work was performed on 02/27/2019.
- Monroe County Surveyor's Field Book 53, page 38.
- Project Name: T08NR01W-09-10, Field work by: RSO & TER, Drawn by: RSO, Reviewed by: RSO, TER & SRB.
- The basis of bearings is Grid North NAD83(2011), Indiana West Zone, Epoch 2010.0000, Geoid Model G2012BU7, Datum NAD83_NO_TRANS, US Survey Feet, derived from GPS observations utilizing the Indiana Real-Time Network (INCORS). Distances obtained with GPS have not been adjusted to ground. Coordinate data was collected with a Javad Triumph LS Network Rover.
- Vicinity sketch was compiled per 2014 aerial photography.
- This monument was witnessed by the Monroe County Surveyor, Kevin Enright, on 2/20/1998. We collected coordinates on the known monument in preparation for an upcoming construction project in the area. A complete survey history has not yet been performed to prove the validity of this monument.

WITNESS MONUMENT TIES

ID	BEARING	DISTANCE	DESCRIPTION
Witness A	S 48d W	69.9'	Northeast corner of Frank Southern Ice Arena
Witness B	N 65d E	46.8'	Mag nail found in powerline pole (old witness, checked distance, did not check bearing)
Witness C	S 2d E	131.0'	Cut X in fire hydrant flange bolt (old witness, did not check bearing or distance)

MONUMENT ACCESSORIES

Other survey grade monuments that were located in the vicinity and their relation to the monument.

(#10137)	N 50d10'44" E	56.27'	Cut X in the southwest rim of a sanitary sewer manhole (CAUTION: there is another cut X in the north side of the manhole)
(#10140)	S 1d29'36" E	131.23'	Cut X in the west rim of the water valve 1.05' west of the cut X in fire hydrant flange bolt (Witness C above)
(#10149)	S 52d38'42" W	46.78'	Cut X in the west rim of water manhole

▲ **Monument Description:** $\frac{5}{8}$ " rebar with no cap found 0.2' below grade. Added a 2" aluminum Berntsen cap stamped "MONROE CO. SURVEYOR"

State Plane Grid Coordinates: Point No.:10127 Northing: 1419112.0', Easting: 3110570.2'

SHEET
1
OF
2

MONUMENT RECORD
CORNER ID:
Per_K07

Center 1/4 Corner
Section 09- T08N-R01W
Perry Township
Monroe County, Indiana



OFFICE OF THE MONROE COUNTY SURVEYOR
Trohn Enright-Randolph Monroe County Surveyor
Rachel Savich Oser Professional Surveyor
119 West 7th Street, Bloomington, IN 47404 (812) 349-2570

Photos were taken on 02/27/2019 with an iPhone 6s



Trohn Enright-Randolph
Trohn Enright-Randolph
Monroe County Surveyor



Accepted by the Monroe
County Surveyor Review Board
on 09/10/2019



Rachel Oser
Rachel Savich Oser, State of Indiana
Professional Surveyor No. 21100022

SHEET
2
OF
2

MONUMENT RECORD
CORNER ID:
Per_K07

Center 1/4 Corner
Section 09- T08N-R01W
Perry Township
Monroe County, Indiana



OFFICE OF THE MONROE COUNTY SURVEYOR
Trohn Enright-Randolph Monroe County Surveyor
Rachel Savich Oser Professional Surveyor
119 West 7th Street, Bloomington, IN 47404 (812) 349-2570

MONUMENT RECORD
State of Indiana - County of Monroe


Section: 09

Township: 8 North

Range: 1 West

Corner ID: Per K-07


Monument Description & Remarks: Found 5/8" Rebar with "SNA" cap at center of section. Rebar was set by Smith Neubecker Engineering to replace referenced stone which was obliterated during development to the SE.
References on file in the County Surveyor's Office: Referenced by Jess Gwinn, R.L.S., Smith Neubecker & Associates.

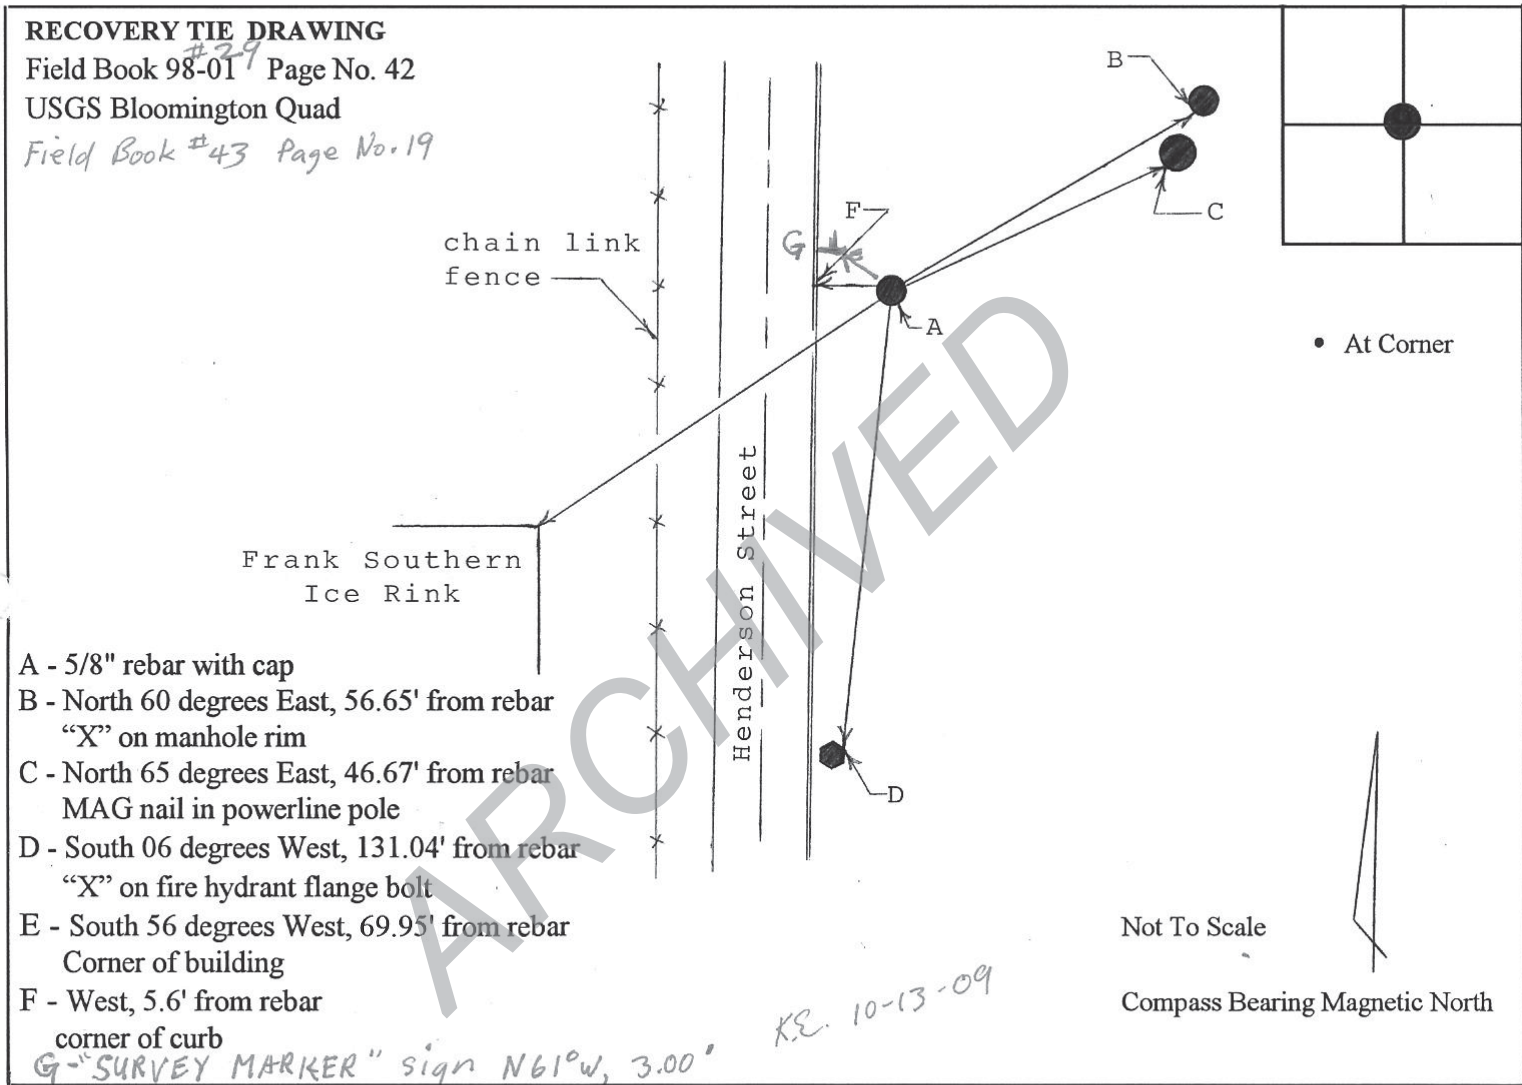

I, Kevin P. Enright, Monroe County Surveyor, hereby certify that this document was prepared under my direction in accordance with the provisions of Section 36-2-12-11 of the Indiana Code; and the above data is given under my hand and seal this 20th day of February, 1999.

Kevin P. Enright

Administered by: Surveyor Review Board

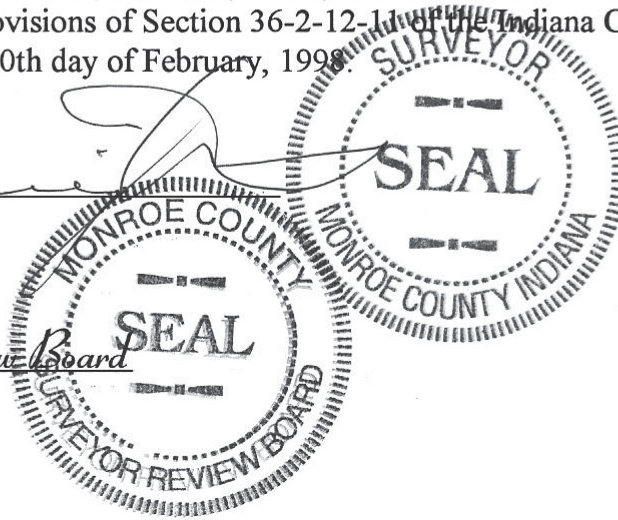

MONUMENT RECORD
State of Indiana - County of Monroe


Section: 09

Township: 8 North




Range: 1 West

Corner ID: Per K-07

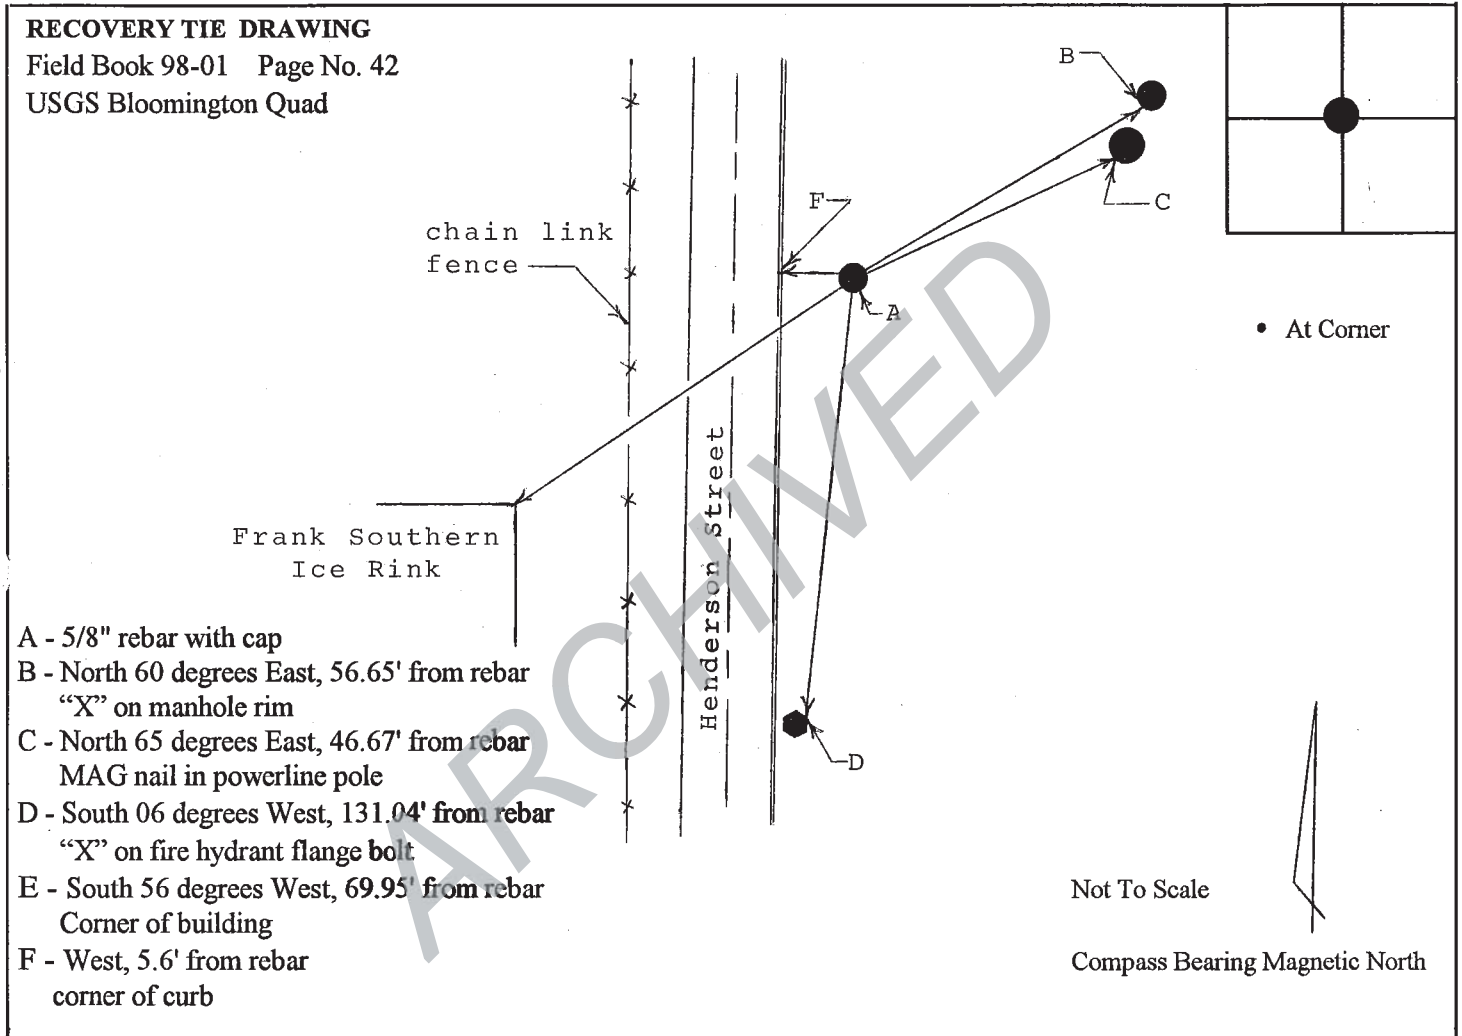Monument Description & Remarks: Found 5/8" Rebar with "SNA" cap at center of section. Rebar was set by Smith Neubecker Engineering to replace referenced stone which was obliterated during development to the SE.
References on file in the County Surveyor's Office: Referenced by Jess Gwinn, R.L.S., Smith Neubecker & Associates.

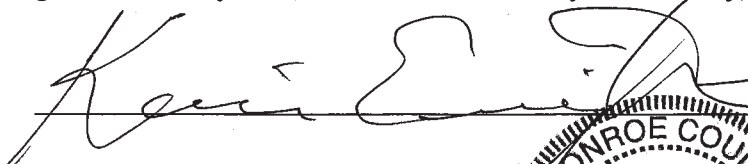

I, Kevin P. Enright, Monroe County Surveyor, hereby certify that this document was prepared under my direction in accordance with the provisions of Section 36-2-12-11 of the Indiana Code; and the above data is given under my hand and seal this 20th day of February, 1998.




Administered by: Surveyor Review Board